



Non-Contact Air Proximity Switch



Non-Contact Air Proximity Switch with no moving parts; will sense any flat or curved object which presents a sensing surface of 1/4" or more to the sensing nozzle

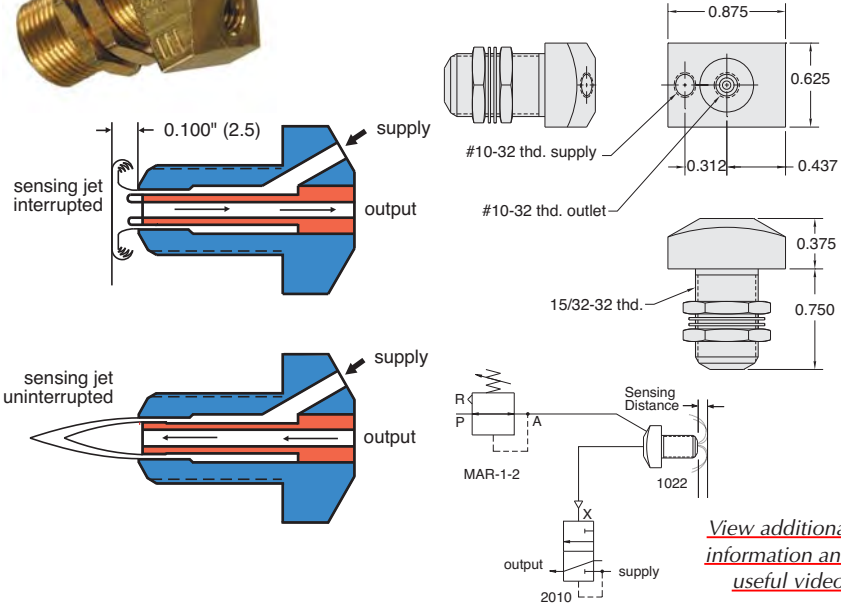

Medium: Air
Input Pressure: 4 to 10 psig
Nominal Proximity Distance: 0.100"
Output Signal at 4 psig supply: Normal: -2" H₂O
 actuated: 7 1/2" H₂O
Frequency Response: 500 CPM
Air Consumption: 0.3 scfm
Sensing Capability: Flat or curved surfaces with 1/8" minimum radius
Connections: #10-32 female
Construction: Solid brass bright dipped

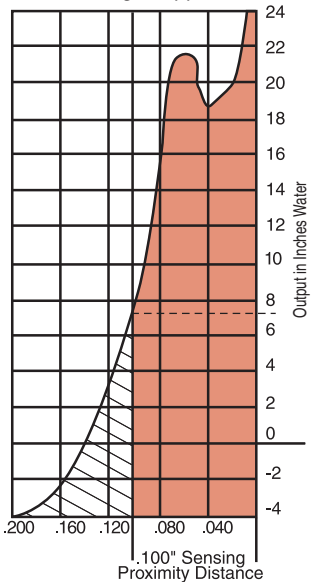


[View additional information and useful videos](#)

Part No.	Description
1022	Non-Contact Air Limit Switch, #10-32


Non-Contact Gap Sensor



Non-Contact Gap Sensor will sense any flat or round object with a 1/32" minimum radius. Produces a positive signal when no object is present and a negative signal when an object interrupts its sensing system

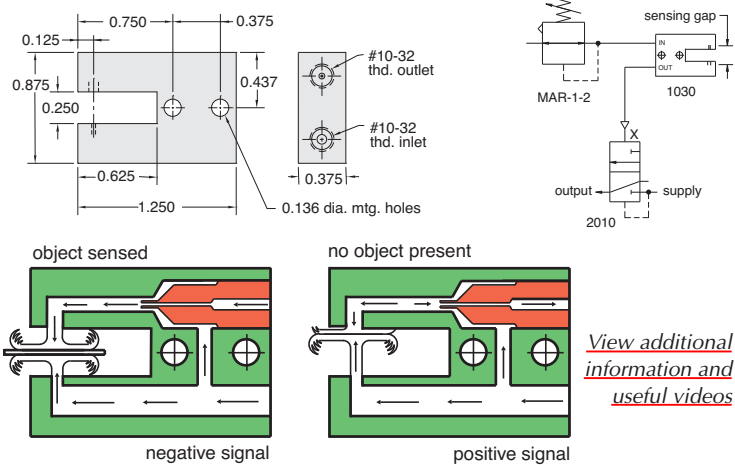

Medium: Air
Input Pressure: 0.5 to 5 psig
Output: -3" to 26" H₂O @ 4 psig
Frequency Response: 1,000 cpm
Air Consumption: 1/4 scfm @ 4 psig
Sensing Capability: Flat or curved surfaces with 1/32" minimum radius. May be used for up to 4" gap with an additional auxiliary jet
Connections: #10-32 female
Construction: Solid brass bright dipped

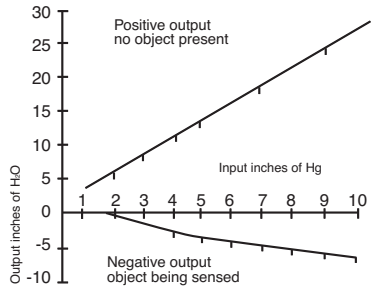

[View additional information and useful videos](#)

Part No.	Description
1030	Non-Contact Positive Pressure Sensor, #10-32